

## Case 337 : Narrative

Case Vehicle (A): 1999 Chevrolet	Vehicle (B): 1988 Buick
Type: Geo Metro LSi, 4-door sedan	Type: Electra Park Avenue, 4-door sedan
Driver: 65-year-old male	Driver: 19-year-old female
CDC: 11-FDEW-4	CDC: 99-0000-0

### SITUATION

[1](#) [2](#) On a clear day, case vehicle (A) was traveling south at a driver-estimated speed of 45-mph (72 kph) in the southbound lane of a two-lane asphalt road, in a rural area. [3](#) Vehicle (B) was traveling north at an unknown speed in the northbound lane of the same two-lane roadway. The roads were dry and the speed limit was 55 mph (89 kph). [4](#) The roadway was under construction with orange barrels in the center lane. The northbound lane was posted with no-left-turn signs, restricting traffic from turning at the intersecting road. [5](#) As case vehicle (A) entered the intersection, the driver of vehicle (B) began to turn left. The driver of case vehicle (A) applied the brakes and tried to steer to the left, but was unable to avoid vehicle (B), and the front of case vehicle (A) struck the right side of vehicle (B) in a T-type configuration. Both vehicles were towed from the scene.

The police report indicated "C " level injuries for the driver of case vehicle (A), but he did not seek treatment immediately after the crash. The police report indicated "A" level injuries for the right-front occupant, and she was transported to a local hospital and later transferred to a trauma center for additional treatment. The police report indicated "B-" level injuries for the driver of vehicle (B), but she did not seek treatment.

## GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[6](#) Damage to case vehicle (A) was moderate. Direct damage began at the left-front bumper corner and extended 145-cm across the entire front. The maximum crush was 62 cm at the right-front bumper corner. Vehicle (B) was not available for inspection.

[7](#) [8](#) [9](#) [10](#) [11](#) Using the missing-vehicle option of the WinSMASH vehicle crash-reconstruction program and c-values measured for case vehicle (A), the following impact severities were calculated for the frontal impact:

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	45 (28)	-43 (-27)	16 (10)
Vehicle (B)	delta V	28 (18)	-27 (-17)	-10 (-6)

## DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

### Exterior

[12](#) The frontal impact crushed the front bumper, damaged the grille, displaced both headlight assemblies, and broke the right headlight assembly. [13](#) The front end of the vehicle was shifted slightly to the right. [14](#) The front portion of the hood was crushed and the center portion were buckled up and to the rear. The damaged hood latch was jammed, and both hood hinges were deformed but not separated. The rear edge of the hood was elevated but it did not contact the windshield. There was a small crack in the upper-center portion of the windshield due to occupant contact.

[15](#) On the right side, the fender was crushed to the rear and to the right. The right-front wheel was damaged and rotation of the wheel was restricted by the crushed fender. [16](#) Right-front wheel damage reduced the right wheelbase by 10 cm. [17](#) There was no damage to the upper or lower portions of the right A-, B-, or C-pillars, and the right-side windows were not broken. The right-front door was slightly ajar, but the door was operational. [18](#) There was no damage to the right-rear door, and it was operational. [19](#) There was no damage to the right-rear wheel.

[20](#) On the left side, the fender was crushed to the rear and to the right. [21](#) [22](#) There was no damage to the left wheels and there was no significant change to the left wheelbase. [23](#) There was no damage to the upper or lower portions of the right A-, B-, or C-pillars, and the left-side windows were not broken. [24](#) There was no damage to the left-side doors and both were operational. [25](#) [26](#) There were scratches to the rear bumper cover, which did not appear to be associated with this crash.

## **Interior**

[27](#) This vehicle is equipped with steering-wheel and dash-mounted frontal-impact airbags, which deployed during the frontal impact. [28](#) [29](#) [30](#) There was a small black mark and droplets of blood on the upper-center portion of the driver airbag. [31](#) [32](#) There was no damage to the steering wheel and no rotation of the steering column. [33](#) There was no damage to the left portion of the roof or sunvisor, or to the left A-pillar. The upper and mid portions of the instrument panel were undamaged, but [34](#) there were scuff marks on the right portion of the driver knee bolster. [35](#) There was no deformation to the floor in the driver area, and there was no damage to the brake or accelerator pedals.

[36](#) There was no damage to the center portions of the windshield header, the roof structure, or the roof headliner. [37](#) [38](#) The rearview mirror glass was cracked

and detached from its mount, and the windshield was cracked to the left of the rearview mirror from occupant contact. [39](#) [40](#) [41](#) The center vertical console was scuffed and the forward portion of the floor console was displaced, cracked, and scuffed from contact by the right-front passenger.

[42](#) In the right-front seating area, the windshield header, the roof structure, and the headliner were undamaged. Also, there was no damage to the right A-pillar.

[43](#) The sunvisor was not available for inspection. [44](#) There was no damage to, or contact marks on, the passenger frontal-impact airbag, although there was blood on the airbag skin. [45](#) There was no damage to the glove compartment door, [46](#) but there were some light scuff marks to the left of the glove compartment. [47](#) There was no deformation to the floor in the right-front area and there were no intrusions.

## **OCCUPANT KINEMATICS AND INJURIES**

[48](#) The 65-year-old, 6-ft, 202-lb male driver was using the three-point belt and the steering-wheel airbag deployed. [49](#) [50](#) Webbing imprints on the plastic D-ring and on the [51](#) shoulder-belt webbing indicate belt use at the time of the crash. The driver reportedly had adjusted the seat to a mid-to-rear track position. He reportedly applied the brakes, had both of his hands bracing on the steering wheel, and may have steered slightly to the left just before the crash occurred. During the frontal impact, the driver moved forward and to the left relative to the vehicle interior into the lap and shoulder belts and airbag. He sustained a contusion to the center of the chest due to loading by the shoulder belt. He also sustained fractures to the left and right wrists, probably due to bracing on the steering-wheel rim during the crash. [52](#) Scuff marks on the right portion of the driver knee bolster indicate knee contact, but the driver did not sustain any associated injuries.

[53](#) The 72-year-old, 5-ft, 4-in, 113-lb female right-front passenger was not using the three-point belt and the airbag deployed. [54](#) [55](#) There was no evidence of belt use on the D-ring or the shoulder-belt webbing. The right-front passenger reportedly had adjusted the seat to a mid-to rear-track position.

[56](#) During the frontal impact, she moved forward and to the left relative to the vehicle interior, into the airbag and center stack. She sustained abrasions to the chin and neck, possibly from contact by the deploying airbag. [57](#) She sustained a contusion to the left cheek, possibly from contact with the rearview mirror, as indicated by a crack in the mirror glass, hair stuck in the cracks, [58](#) and skin oil on the mirror. [59](#) [60](#) She sustained contusions to the chest, possibly from contact with the vertical console. [61](#) [62](#) She sustained contusions and lacerations to the lateral and medial aspects of the left and right arms and forearms, possibly from contact by the deploying airbag. [63](#) [64](#) Her left knee contacted the vertical console as evidenced by scuff marks and deformation, resulting in comminuted fractures to the posterior column and anterior wall of the left acetabulum, with hip dislocation, and contusions to the left medial knee. She sustained a contusion to the left calf, possibly from contact with the seat.

The following tables [65](#) [66](#) and attached drawings summarize the injuries for the two occupants.

Occupant: Driver	Age: 65 years	Gender: Male		
Restraints: 3-point belt, steering-wheel airbag	Stature: 183 cm (6 ft)	Mass: 92 kg (202 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Contusion, center of chest	1	Shoulder belt	—	—

Fracture, left wrist	2	—	Steering-wheel rim (bracing)	—
Fracture, right wrist	2	—	Steering-wheel rim (bracing)	—
Maximum A.I.S. Level	2	—	—	—
Injury Severity Score	5	—	—	—

Occupant: Right front	Age: 72 years	Gender: Female		
Restraints: Dash-mounted airbag	Stature: 163 cm (5 ft, 4 in)	Mass: 51 kg (113 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Abrasion, chin	1	—	—	Airbag
Abrasion, neck	1	—	—	Airbag
Contusion, left cheek	1	—	—	Rearview mirror
Contusions, chest	1	—	—	Vertical console
Contusions, lateral and medial aspects of the left arm and forearm	1	—	—	Airbag
Lacerations, lateral and medial aspects of the left arm and forearm	1	—	—	Airbag
Contusions, lateral and medial aspects of the right arm and forearm	1	—	—	Airbag
Lacerations, lateral and medial aspects of the right arm and forearm	1	—	—	Airbag
Comminuted acetabular fractures, left posterior column and anterior wall, with hip dislocation	3	—	Vertical console	—
Contusion, medial aspect of left knee	1	—	Vertical console	—
Contusion, left calf	1	—	—	Seat
Maximum A.I.S. Level	3	—	—	—
Injury Severity score	10	—	—	—

CASE NO.: 88P-02

CASE VEHICLE: 1989 Chevrolet


TYPE: Gasoline LBL 4 door sedan

EXPLAN: 38-year-old male

STATUS: 5'8" tall (6'6") MASS: 68 kg (150 lb)

REMARKS: 3 point belt, steering wheel strap

SEVERITY: (LAC) - 2 (SC) - 5



CASE NO.: 33740

CASE REFERENCE: F008 Chevrolet

TYPE: One Motor LBL, 4-door sedan

DOCUMENT: (Paper-based) 70-year-old female

STATUS: (R) Status (R, N, A, G)

STATUS: M ag (Y/N/A)

REMARKS: (See attached sheet)

SPRINT: (See sheet)


SS: 10





1998, 1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 2676, 2677, 2678, 2679, 26

**Abstract**



## General Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	2	Rural	<a href="#">more</a>
V207 — Limited Access Highway	0	No	<a href="#">more</a>
V208 — Road Total Lanes	2	2 lanes	<a href="#">more</a>
V209 — Intersecting Road Total Lanes	2	2 lanes	<a href="#">more</a>
V210 — Road Surface Type	1	Asphalt	<a href="#">more</a>
V211 — Road Defects	0	No	<a href="#">more</a>
V212 — Construction Zone	1	Yes	<a href="#">more</a>
V213 — Road Alignment Vertical Plane	1	Level	<a href="#">more</a>
V214 — Road Alignment Horizontal Plane	1	Straight	<a href="#">more</a>
V215 — Surface Covering	10	Dry	<a href="#">more</a>
V216 — Visibility Limitation	0	None	<a href="#">more</a>
V217 — Visibility Obstruction	0	None	<a href="#">more</a>
V218 — Speed Limit	6	86-90 km/h .. 55 mph	<a href="#">more</a>
V219 — Precipitation Type	0	None	<a href="#">more</a>
V220 — Precipitation Rate	8	Not applicable	<a href="#">more</a>
V221 — Temperature	9	Unknown	<a href="#">more</a>
V222 — Crosswind	9	Unknown	<a href="#">more</a>
V223 — Light Conditions	1	Daylight	<a href="#">more</a>
V224 — Mechanical Malfunction Mention	0	No	<a href="#">more</a>
V225 — Case Vehicle and Object	0	No	<a href="#">more</a>
V226 — Case Vehicle Rollover	0	No	<a href="#">more</a>
V227 — Case Vehicle Ran Off	0	No	<a href="#">more</a>

Roadway			
V228 — Moving Case Vehicle/Contacted Moving Vehicle	1	Yes	<a href="#">more</a>
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	<a href="#">more</a>
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	<a href="#">more</a>
V231 — Total Vehicles Hit By Case Vehicle	1	1 vehicle	<a href="#">more</a>
V232 — Any Fire in Crash	0	No	<a href="#">more</a>
V233 — Max Police Severity-PAR	3	A - Incapacitating Injury	<a href="#">more</a>
V234 — Driver Alcohol Involvement	0	Had not been drinking	<a href="#">more</a>
V235 — Driver Alcohol BAC	80	Not tested	<a href="#">more</a>
V236 — Driver Impairment Mention	0	No	<a href="#">more</a>
V237 — Driven/Towed From Scene	2	Towed Due to Damage	<a href="#">more</a>

## Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN	1G4CW51C9J14	—	—
V302 — Other Vehicle Manufacturer/Body Code	11129	—	—
V303 — Other Vehicle Manufacturer	111	Buick	<a href="#">more</a>
V304 — Other Vehicle Body Code	29	Full 110-114.9 in. wb.	<a href="#">more</a>
V305 — Other Vehicle Make/Model	0431	Electra (Electra 225)	<a href="#">more</a>
V306 — Other Vehicle Model Year	1988	—	—

V307 — Other Vehicle Mass	001505 kg	—	—
V308 — Other Vehicle Number	0	No separate report	<a href="#">more</a>
V309 — Other Vehicle Number of Occupants	01	—	—
V310 — Other Vehicle Traveling Speed	997	Speed not excessive (but unknown)	<a href="#">more</a>
V311 — Highest Police Injury Severity	2	B - Non-Incapacitating Injury	<a href="#">more</a>
V312 — Other Vehicle Type	29	Full 110-114.9 in. wb.	<a href="#">more</a>
V313 — Other Vehicle Wheelbase (cm)	282 cm	—	—
V314 — Average Track Width	999	Unknown	<a href="#">more</a>
V315 — Overall Length	500 cm	—	—
V316 — Overall Width (OAW)	183 cm	—	—
V317 — Front Overhang (FOH)	112 cm	—	—
V318 — Rear Overhang (ROH)	106 cm	—	—
V319 — Undeformed End Width (UEW)	999	Unknown	<a href="#">more</a>
V320 — Engine Displacement	3.8 l	—	—
V321 — Engine: Number of Cylinders	06	—	—
V322 — Direct Damage Length (DDL)	999	Unknown	<a href="#">more</a>
V323 — Front-End Overlap % (FEO)	99	Missing or Not applicable	<a href="#">more</a>
V324 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	<a href="#">more</a>

## Case Vehicle

### General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	2C1MR5229X67	—	—
V402 — Manufacturer/Body Code	21325	—	—
V403 — Vehicle Manufacturer	213	Chevrolet	<a href="#">more</a>
V404 — Vehicle Body Code	25	—	—
V405 — Make/Model Code	0135	Geo Metro	<a href="#">more</a>
V406 — Model Year	1999	—	—
V407 — Vehicle Mass	000872 kg	—	—
V408 — Odometer Reading	038914 miles	—	—
V409 — Number of Occupants	02	—	—
V410 — Traveling Speed	077 kph	—	—
V411 — Body Type	14	4-door sedan	<a href="#">more</a>
V412 — Stolen Vehicle	8	Not currently collected	<a href="#">more</a>
V413 — Body Structure	2	Unitized	<a href="#">more</a>
V414 — Transmission Type	1	Automatic	<a href="#">more</a>
V415 — Transmission Lever Location	2	Console	<a href="#">more</a>
V416 — Steering	1	Power	<a href="#">more</a>
V417 — Brakes	1	Power	<a href="#">more</a>
V418 — Brake Type	2	Disc - front wheels	<a href="#">more</a>
V419 — Brake Anti-lock Device	1	Two-wheel	<a href="#">more</a>
V420 — Air Conditioning in Vehicle	8	Not currently collected	<a href="#">more</a>
V421 — Drive Type	2	Front wheel	<a href="#">more</a>
V422 — Dual Rear Wheels	0	No	<a href="#">more</a>

V423 — Original Restraint System Type	3	Airbag	<a href="#">more</a>
V424 — Equipped With Roll Bar	0	No	<a href="#">more</a>
V425 — Roof Type	1	Solid	<a href="#">more</a>
V426 — Wheelbase	237 cm	—	—
V427 — Anti-lacerative Glass	0	None	<a href="#">more</a>
V428 — Average Track Width	138 cm	—	—
V429 — Overall Length	417 cm	—	—
V430 — Overall Width (OAW)	159 cm	—	—
V431 — Front Overhang	083 cm	—	—
V432 — Rear Overhang	097 cm	—	—
V433 — Undeformed End Width (UEW)	145 cm	—	—
V434 — Engine Displacement	2.3 l	—	—
V435 — Engine: Number of Cylinders	04	—	—
V436 — Direct Damage Length (DDL)	145 cm	—	—
V437 — Front End Overlap % (FEO)	99	Missing or Not applicable	<a href="#">more</a>
V438 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	<a href="#">more</a>

## Case Vehicle

### Damage

### Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	062 cm	—	—
V502 — Maximum Crush - Right Side	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>

V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V504 — Maximum Crush - Left Side	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V507 — Are Events In Chronological Order	1	Yes	<a href="#">more</a>
V508 — Event 1 Impact Location	1	On Roadway	<a href="#">more</a>
V509 — Event 1 Impact Configuration	11	FRONT of case veh - FRONT of contacted Vehicle	<a href="#">more</a>
V510 — Event 1 Object/Vehicle Contacted	29	Full 110-114.9 in. wb.	<a href="#">more</a>
V511 — Event 2 Impact Location	8	No 2nd event	<a href="#">more</a>
V512 — Event 2 Impact Configuration	88	No 2nd event	<a href="#">more</a>
V513 — Event 2 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V514 — Event 3 Impact Location	8	No 3rd event	<a href="#">more</a>
V515 — Event 3 Impact Configuration	88	No 3rd event	<a href="#">more</a>
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V517 — Event 4 Impact Location	8	No 4th event	<a href="#">more</a>
V518 — Event 4 Impact Configuration	88	No 4th event	<a href="#">more</a>
V519 — Event 4 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V520 — Event 5 Impact Location	8	No 5th event	<a href="#">more</a>
V521 — Event 5 Impact Configuration	88	No 5th event	<a href="#">more</a>
V522 — Event 5	00	No object/vehicle contacted	<a href="#">more</a>

Object/Vehicle Contacted			
V523 — Event 6 Impact Location	8	No 6th event	<a href="#">more</a>
V524 — Event 6 Impact Configuration	88	No 6th event	<a href="#">more</a>
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V526 — Event 7 Impact On Road	8	No 7th event	<a href="#">more</a>
V527 — Event 7 Impact Configuration	88	No 7th event	<a href="#">more</a>
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V529 — Primary CDC Case Vehicle -event Number	1	Event 1	<a href="#">more</a>
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	<a href="#">more</a>
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V532 — Primary CDC Case Vehicle -crush	062	—	—
V533 — Primary CDC Case Vehicle -clock #1	11	11 o'clock	<a href="#">more</a>
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	<a href="#">more</a>
V535 — Primary CDC Case Vehicle letter 2 #1	04	D - Distributed (Side or End)	<a href="#">more</a>
V536 — Primary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V538 — Primary CDC Case Vehicle Extent #1	04	Extent 4	<a href="#">more</a>
V539 — Primary CDC Case Vehicle -CDC #1	11FDEW4	—	—
V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>



V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V549 — Primary CDC Contacted Vehicle -crush	999	Unknown	<a href="#">more</a>
V550 — Primary CDC Contacted Vehicle -clock #1	99	Unknown or no damage	<a href="#">more</a>
V551 — Primary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V552 — Primary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V553 — Primary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V554 — Primary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V555 — Primary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V556 — Primary CDC Contacted Vehicle -CDC #1	9900000	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>

V563 — Primary CDC Contacted Vehicle -CDC #2	9900000	—	—
V564 — Secondary CDC Case Vehicle - Event No	8	Not applicable	<a href="#">more</a>
V565 — Secondary CDC Case Vehicle - Impact Speed	998	Not Applicable	<a href="#">more</a>
V566 — Secondary CDC Case Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	<a href="#">more</a>
V567 — Secondary CDC Case Vehicle -crush	998	Not Applicable	<a href="#">more</a>
V568 — Secondary CDC Case Vehicle -clock #1	98	Not Applicable	<a href="#">more</a>
V569 — Secondary CDC Case Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V570 — Secondary CDC Case Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V571 — Secondary CDC Case Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V572 — Secondary CDC Case Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V573 — Secondary CDC Case Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V574 — Secondary CDC Case Vehicle -CDC #1	9800000	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	<a href="#">more</a>
V583 — Secondary CDC	8	Not applicable (no	<a href="#">more</a>

Contacted Vehicle - Estimated By		vehicle/no impact)	
V584 — Secondary CDC Contacted Vehicle -crush	998	Not Applicable	<a href="#">more</a>
V585 — Secondary CDC Contacted Vehicle -clock #1	98	Not Applicable	<a href="#">more</a>
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V588 — Secondary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V591 — Secondary CDC Contacted Vehicle -CDC #1	9800000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V598 — Secondary CDC Contacted Vehicle -CDC #2	9800000	—	—

## Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total	045 kph	—	—

Delta-V			
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	-043 kph	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	0016 kph	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	0680 kJ	—	—
V606 — Primary Impact Case Vehicle -reconstruction	22	Reconstructed, moderate confidence level	<a href="#">more</a>
V607 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	028 kph	—	—
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	-027 kph	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	-010 kph	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	0776 kJ	—	—
V612 — Case Vehicle Secondary Impact Number	8	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	888	N/A	<a href="#">more</a>
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	8888	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	8888	—	—
V617 — Secondary Case Vehicle Reconstruction Note	88	—	—
V618 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	<a href="#">more</a>
V619 — Secondary Contacted	888	N/A	<a href="#">more</a>

Vehicle Reconstructed Total Delta-V			
V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	045 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-043 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	0016 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0680 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	<a href="#">more</a>
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V630 — Primary Contacted Vehicle Reconstruction Total EBS	028 kph	—	—
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	-027 kph	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	-010 kph	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	0776 kJ	—	—
V634 — Case Vehicle Secondary Impact Number	8	Not applicable	<a href="#">more</a>
V635 — Secondary Case Vehicle Reconstruction Total EBS	888	N/A	<a href="#">more</a>

V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	8888	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	8888	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	8888	—	—
V639 — Secondary Case Vehicle Reconstruction Note	88	—	—
V640 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	<a href="#">more</a>
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	888	N/A	<a href="#">more</a>
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	<a href="#">more</a>
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	145 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	062 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	145 cm	—	—
V650 — Case Vehicle Impact 1 C1	025 cm	—	—
V651 — Case Vehicle Impact 1 C2	017 cm	—	—
V652 — Case Vehicle Impact 1 C3	021 cm	—	—
V653 — Case Vehicle Impact 1 C4	028 cm	—	—
V654 — Case Vehicle Impact 1	040 cm	—	—

C5			
V655 — Case Vehicle Impact 1 C6	062 cm	—	—
V656 — Case Vehicle Impact 1 +/- D	0000 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	1	—	—
V658 — Case Vehicle Impact 2 Plane	9	Unknown	<a href="#">more</a>
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	999	Unknown	<a href="#">more</a>
V660 — Case Vehicle Impact 2 Max Crush	999	Unknown	<a href="#">more</a>
V661 — Case Vehicle Impact 2 Field-L	999	Unknown	<a href="#">more</a>
V662 — Case Vehicle Impact 2 C1	999	Unknown	<a href="#">more</a>
V663 — Case Vehicle Impact 2 C2	999	Unknown	<a href="#">more</a>
V664 — Case Vehicle Impact 2 C3	999	Unknown	<a href="#">more</a>
V665 — Case Vehicle Impact 2 C4	999	Unknown	<a href="#">more</a>
V666 — Case Vehicle Impact 2 C5	999	Unknown	<a href="#">more</a>
V667 — Case Vehicle Impact 2 C6	999	Unknown	<a href="#">more</a>
V668 — Case Vehicle Impact 2 +/- D	0999 cm	—	—
V669 — Other Vehicle Reconstructed Impact Number	2	—	—
V670 — Other Vehicle Impact 1 Plane	8	Not applicable	<a href="#">more</a>
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	998	Not applicable	<a href="#">more</a>
V672 — Other Vehicle Impact 1 Max Crush	998	Not applicable	<a href="#">more</a>
V673 — Other Vehicle Impact 1 Field-L	998	Not applicable	<a href="#">more</a>

V674 — Other Vehicle Impact 1 C1	998	Not applicable	<a href="#">more</a>
V675 — Other Vehicle Impact 1 C2	998	Not applicable	<a href="#">more</a>
V676 — Other Vehicle Impact 1 C3	998	Not applicable	<a href="#">more</a>
V677 — Other Vehicle Impact 1 C4	998	Not applicable	<a href="#">more</a>
V678 — Other Vehicle Impact 1 C5	998	Not applicable	<a href="#">more</a>
V679 — Other Vehicle Impact 1 C6	998	Not applicable	<a href="#">more</a>
V680 — Other Vehicle Impact 1 +/- D	9998	—	—
V681 — Other Vehicle Reconstructed Impact Number	2	—	—
V682 — Other Vehicle Impact 2 Plane	8	Not applicable	<a href="#">more</a>
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	998	Not applicable	<a href="#">more</a>
V684 — Other Vehicle Impact 2 Max Crush	998	Not applicable	<a href="#">more</a>
V685 — Other Vehicle Impact 2 Field-L	998	Not applicable	<a href="#">more</a>
V686 — Other Vehicle Impact 2 C1	998	Not applicable	<a href="#">more</a>
V687 — Other Vehicle Impact 2 C2	998	Not applicable	<a href="#">more</a>
V688 — Other Vehicle Impact 2 C3	998	Not applicable	<a href="#">more</a>
V689 — Other Vehicle Impact 2 C4	998	Not applicable	<a href="#">more</a>
V690 — Other Vehicle Impact 2 C5	998	Not applicable	<a href="#">more</a>
V691 — Other Vehicle Impact 2 C6	998	Not applicable	<a href="#">more</a>
V692 — Other Vehicle Impact 2 +/- D	9998	—	—



## Case Vehicle

### Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	0	No	<a href="#">more</a>
V702 — Right Front Wheel Damaged	0	No	<a href="#">more</a>
V703 — Right Rear Wheel Damaged	0	No	<a href="#">more</a>
V704 — Left Rear Wheel Damaged	0	No	<a href="#">more</a>
V705 — Left Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V706 — Right Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V707 — Right Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V708 — Left Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V709 — Left Front Carcass Construction	3	Radial	<a href="#">more</a>
V710 — Right Front Carcass Construction	3	Radial	<a href="#">more</a>
V711 — Right Rear Carcass Construction	3	Radial	<a href="#">more</a>
V712 — Left Rear Carcass Construction	3	Radial	<a href="#">more</a>
V717 — Left Front Tire Size	P15580R13	—	—
V718 — Right Front Tire Size	P15580R13	—	—
V719 — Right Rear Tire Size	P15580R13	—	—
V720 — Left Rear Tire Size	P15580R13	—	—

## Case Vehicle

### Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	<a href="#">more</a>
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	<a href="#">more</a>
V803 — Main Filler Cap Location	113	Left of frame laterally - above vertically	<a href="#">more</a>
V804 — Main Tank Material	9	Unknown	<a href="#">more</a>
V805 — Aux Tank Type	8	Not applicable (not equipped)	<a href="#">more</a>
V806 — Aux Tank Location	888	Not applicable (not equipped)	<a href="#">more</a>
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	<a href="#">more</a>
V808 — Aux Tank Material	8	Not applicable	<a href="#">more</a>
V901 — Fuel Leakage From Crash	0	No	<a href="#">more</a>
V1001 — Fire In Or On Case Vehicle	0	No	<a href="#">more</a>

## Case Vehicle

### Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	<a href="#">more</a>
V1102 — Hood Latch Damaged	1	Yes	<a href="#">more</a>
V1103 — Hood Latch Jammed	1	Yes	<a href="#">more</a>
V1104 — Left Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1105 — Left Hood Hinge Separated	0	No	<a href="#">more</a>

V1106 — Right Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1107 — Right Hood Hinge Separated	0	No	<a href="#">more</a>
V1108 — Hood Remained On Vehicle	1	Yes	<a href="#">more</a>
V1109 — Rear Hood Edge Elevated	1	Yes	<a href="#">more</a>
V1110 — Edge Contacted Windshield	0	No	<a href="#">more</a>
V1111 — Edge Penetrated Windshield	8	Not applicable	<a href="#">more</a>
V1112 — Hood Latch Location	1	Front of Vehicle	<a href="#">more</a>
V1113 — Eng/Transmissn Mount Separation	0	No	<a href="#">more</a>
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	<a href="#">more</a>
V1115 — Steerng Column Coupling Damaged	9	Unknown	<a href="#">more</a>
V1116 — Steerng Column Coupling Separated	9	Unknown	<a href="#">more</a>
V1117 — Eng Comp Telescopng Unit	88	Not collected	<a href="#">more</a>
V1118 — Comp Orig/Telescopd Diff	888	Not collected	<a href="#">more</a>
V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1120 — Upper Left A-pillar Separation	0	No	<a href="#">more</a>
V1121 — Lower Left A-pillar Separation	0	No	<a href="#">more</a>
V1122 — Upper Left B-pillar Separation	0	No	<a href="#">more</a>
V1123 — Lower Left B-pillar Separation	0	No	<a href="#">more</a>
V1124 — Upper Left C-pillar Separation	0	No	<a href="#">more</a>
V1125 — Lower Left C-pillar Separation	0	No	<a href="#">more</a>

V1126 — Upper Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1127 — Lower Left D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1128 — Left Front Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1129 — Left Rear Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1130 — Left Front Door Jammed Closed	0	No	<a href="#">more</a>
V1131 — Left Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1132 — Rear Door Type	0	No door (includes pickups)	<a href="#">more</a>
V1133 — Rear Door Opening Cause	8	Not applicable (no rear door)	<a href="#">more</a>
V1134 — Rear Door Jammed Closed	8	Not applicable (no rear door)	<a href="#">more</a>
V1135 — Luggage Partition Damagd	8	Not applicable	<a href="#">more</a>
V1136 — Spare Tire Status	8	Not collected	<a href="#">more</a>
V1137 — Trailer Hitch Type	0	No hitch	<a href="#">more</a>
V1138 — Trailer Type	0	No trailer	<a href="#">more</a>
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1140 — Upper Right A-pillar Separation	0	No	<a href="#">more</a>
V1141 — Lower Right A-pillar Separation	0	No	<a href="#">more</a>
V1142 — Upper Right B-pillar Separation	0	No	<a href="#">more</a>
V1143 — Lower Right B-pillar Separation	0	No	<a href="#">more</a>
V1144 — Upper Right C-pillar Separation	0	No	<a href="#">more</a>
V1145 — Lower Right C-pillar Separation	0	No	<a href="#">more</a>
V1146 — Upper Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>

V1147 — Lower Right D-pillar Separation	8	Not applicable (not equipped)	<a href="#">more</a>
V1148 — Right Front Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1149 — Right Rear Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1150 — Right Front Door Jammed Closed	0	No	<a href="#">more</a>
V1151 — Right Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1152 — Van Rear Door Type	8	Not applicable (not a van)	<a href="#">more</a>
V1153 — Windshield Cracked		Yes	<a href="#">more</a>
V1154 — Windshield Broken	0	No	<a href="#">more</a>
V1155 — Windshield Cracked or Broken by Occupant	0	No	<a href="#">more</a>
V1156 — Bond Separation Extent	0	None	<a href="#">more</a>
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Steering

#### Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	0	None	<a href="#">more</a>
V1202 — Number of Steering Wheel Spokes	4	4 spokes	<a href="#">more</a>
V1203 — Steering Wheel Spoke Damage	0	None	<a href="#">more</a>
V1204 — Column Tilt Feature	1	Yes, equipped (position unknown)	<a href="#">more</a>
V1205 — Column Swing-away Feature	0	Not equipped	<a href="#">more</a>

V1206 — Column Telescoping Feature	0	Not equipped	<a href="#">more</a>
V1207 — Wheel Energy Absorb Device	8	Not collected	<a href="#">more</a>
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	<a href="#">more</a>
V1209 — Column Energy Absorb Device	88	Not collected	<a href="#">more</a>
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	<a href="#">more</a>
V1211 — Shear Capsule Separation	888	Not collected	<a href="#">more</a>
V1212 — Column Vertical Rotation	0	No apparent rotation	<a href="#">more</a>
V1213 — Column Lateral Rotation	0	No apparent rotation	<a href="#">more</a>
V1214 — Steering Wheel Hub Damage	0	None	<a href="#">more</a>

## Case Vehicle

### Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	0	No	<a href="#">more</a>
V1302 — Was Intrusion Catastrophic	8	Not applicable	<a href="#">more</a>
V1303 — Intrusion Number 01	00	No Intrusion, None	<a href="#">more</a>
V1304 — Intrusion 01 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1305 — Intrusion 01 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1306 — Intrusion 01 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1307 — Intrusion 01 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>

V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1310 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1311 — Intrusion 01 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1312 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1313 — Intrusion 01 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1314 — Intrusion Number 02	00	No Intrusion, None	<a href="#">more</a>
V1315 — Intrusion 02 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1316 — Intrusion 02 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1317 — Intrusion 02 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1318 — Intrusion 02 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1320 — Intrusion 02 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1321 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1322 — Intrusion 02 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1323 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1324 — Intrusion 02 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1325 — Intrusion Number 03	00	No Intrusion, None	<a href="#">more</a>
V1326 — Intrusion 03 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1327 — Intrusion 03 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1328 — Intrusion 03 Assoc	0	No Intrusion, None	<a href="#">more</a>

Event Number			
V1329 — Intrusion 03 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1330 — Intrusion 03 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1332 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1333 — Intrusion 03 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1334 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1335 — Intrusion 03 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1336 — Intrusion Number 04	00	No Intrusion, None	<a href="#">more</a>
V1337 — Intrusion 04 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1338 — Intrusion 04 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1339 — Intrusion 04 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1340 — Intrusion 04 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1341 — Intrusion 04 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1346 — Intrusion 04 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1347 — Intrusion Number 05	00	No Intrusion, None	<a href="#">more</a>
V1348 — Intrusion 05 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>



V1349 — Intrusion 05 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1350 — Intrusion 05 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1351 — Intrusion 05 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1352 — Intrusion 05 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1357 — Intrusion 05 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1358 — Intrusion Number 06	00	No Intrusion, None	<a href="#">more</a>
V1359 — Intrusion 06 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1360 — Intrusion 06 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1361 — Intrusion 06 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1362 — Intrusion 06 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1363 — Intrusion 06 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1364 — Intrusion 06 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1368 — Intrusion 06 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>

V1369 — Intrusion Number 07	00	No Intrusion, None	<a href="#">more</a>
V1370 — Intrusion 07 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1371 — Intrusion 07 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1372 — Intrusion 07 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1373 — Intrusion 07 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1376 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1377 — Intrusion 07 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1378 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1379 — Intrusion 07 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1380 — Intrusion Number 08	00	No Intrusion, None	<a href="#">more</a>
V1381 — Intrusion 08 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1382 — Intrusion 08 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1383 — Intrusion 08 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1385 — Intrusion 08 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1387 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1389 — Intrusion 08	00	No contact or no intrusion	<a href="#">more</a>

Occupant Number			
V1390 — Intrusion 08 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1391 — Intrusion Number 09	00	No Intrusion, None	<a href="#">more</a>
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1402 — Intrusion Number 10	00	No Intrusion, None	<a href="#">more</a>
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>

V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1413 — Door Intrusion Number 01	88	Not Applicable	<a href="#">more</a>
V1414 — Door Intrusion Number 01 Cause	8	Not applicable	<a href="#">more</a>
V1415 — Door Intrusion Number 02	88	Not Applicable	<a href="#">more</a>
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	<a href="#">more</a>
V1417 — Door Intrusion Number 03	88	Not Applicable	<a href="#">more</a>
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	<a href="#">more</a>
V1419 — Door Intrusion 01 Component	88	Not Applicable	<a href="#">more</a>
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1422 — Door Intrusion 02 Component	88	Not Applicable	<a href="#">more</a>
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1425 — Door Intrusion 03 Component	88	Not Applicable	<a href="#">more</a>
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1428 — Door Intrusion 04 Component	88	Not Applicable	<a href="#">more</a>
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	<a href="#">more</a>

V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
---	---	----------------	----------------------

## Case Vehicle

### Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	<a href="#">more</a>
V1502 — Driver Airbag Deployed	1	Yes	<a href="#">more</a>
V1503 — Driver Airbag Condition	0	No Damage	<a href="#">more</a>
V1504 — Passenger Airbag Equip	1	Yes	<a href="#">more</a>
V1505 — Passenger Airbag Deployed	1	Yes	<a href="#">more</a>
V1506 — Passenger Airbag Condition	0	No Damage	<a href="#">more</a>
V1507 — Steering Wheel Airbag Tether	1	Yes	<a href="#">more</a>
V1508 — Driver Airbag Marked By Contact	1	Yes	<a href="#">more</a>
V1509 — Passenger Airbag Tether	0	No	<a href="#">more</a>
V1510 — Passenger Airbag Marked By Contact	1	Yes	<a href="#">more</a>

## Case Vehicle

### Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	0	No	<a href="#">more</a>
V1602 — Right Front Door Damaged	0	No	<a href="#">more</a>
V1603 — Left Front Hardware Damaged	0	No	<a href="#">more</a>
V1604 — Right Front Hardware Damaged	0	No	<a href="#">more</a>
V1605 — Left Front Armrest Damaged	0	No	<a href="#">more</a>
V1606 — Right Front Armrest Damaged	0	No	<a href="#">more</a>
V1607 — Left Front Glass Damaged	0	No	<a href="#">more</a>
V1608 — Right Front Glass Damaged	0	No	<a href="#">more</a>
V1609 — Left Rear Door Area Damaged	0	No	<a href="#">more</a>
V1610 — Right Rear Door Area Damaged	0	No	<a href="#">more</a>
V1611 — Left Rear Hardware Damaged	0	No	<a href="#">more</a>
V1612 — Right Rear Hardware Damaged	0	No	<a href="#">more</a>
V1613 — Left Rear Armrest Damaged	0	No	<a href="#">more</a>
V1614 — Right Rear Armrest Damaged	0	No	<a href="#">more</a>
V1615 — Left Rear Glass Damaged	0	No	<a href="#">more</a>
V1616 — Right Rear Glass Damaged	0	No	<a href="#">more</a>
V1617 — Left Roof Side Rail	0	No	<a href="#">more</a>

Damaged			
V1618 — Right Roof Side Rail Damaged	0	No	<a href="#">more</a>
V1619 — Left B-pillar Damaged	0	No	<a href="#">more</a>
V1620 — Right B-pillar Damaged	0	No	<a href="#">more</a>
V1621 — Left C-pillar Damaged	0	No	<a href="#">more</a>
V1622 — Right C-pillar Damaged	0	No	<a href="#">more</a>
V1623 — Left D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1624 — Right D-pillar Damaged	8	Not applicable	<a href="#">more</a>
V1625 — Left Headlining Damaged	0	No	<a href="#">more</a>
V1626 — Right Headlining Damaged	0	No	<a href="#">more</a>
V1627 — Left Roof Structure Damaged	0	No	<a href="#">more</a>
V1628 — Right Roof Structure Damaged	0	No	<a href="#">more</a>
V1629 — Left T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1630 — Right T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1631 — Other Left Side Item Damaged	8	Not applicable	<a href="#">more</a>
V1632 — Other Right Side Item Damaged	8	Not applicable	<a href="#">more</a>
V1633 — Foot Controls Damaged	0	No	<a href="#">more</a>
V1634 — Ignition Key Damaged	0	No	<a href="#">more</a>
V1635 — Rear View Mirror Damaged	4	Yes, occupant contact	<a href="#">more</a>
V1636 — Sunvisor/Fitting Damaged	6	Right side only	<a href="#">more</a>
V1637 — Windshield Molding Damaged	0	No	<a href="#">more</a>

V1638 — Left A-pillar Damaged	0	No	<a href="#">more</a>
V1639 — Right A-pillar Damaged	0	No	<a href="#">more</a>
V1640 — Center Console Damaged	4	Yes, occupant contact	<a href="#">more</a>
V1641 — Transmission Lever Damaged	0	No	<a href="#">more</a>
V1642 — Horn/Spoke Shroud Damaged	0	No	<a href="#">more</a>
V1643 — Upper Panel Damaged	0	No	<a href="#">more</a>
V1644 — Mid Panel Damaged	0	No	<a href="#">more</a>
V1645 — Lower Panel Damaged	0	No	<a href="#">more</a>
V1646 — Ashtray Damaged	0	No	<a href="#">more</a>
V1647 — Control Knob/Lever Damaged	0	No	<a href="#">more</a>
V1648 — Glove Compartment Area Damaged	0	No	<a href="#">more</a>
V1649 — Instruments Damaged	0	No	<a href="#">more</a>
V1650 — Park Brake Release Damaged	0	No	<a href="#">more</a>
V1651 — Park Brake Pedal Damaged	0	No	<a href="#">more</a>
V1652 — A/C Or Upper Vent Damaged	0	No	<a href="#">more</a>
V1653 — Heater Or A/C Duct Damaged	0	No	<a href="#">more</a>
V1654 — Radio Damaged	0	No	<a href="#">more</a>
V1655 — Other Item Damaged	8	Not applicable	<a href="#">more</a>
V1656 — Rear Window Damaged	0	No	<a href="#">more</a>
V1657 — Rear Window Header Damaged	0	No	<a href="#">more</a>
V1658 — Vertical Console Damaged	4	Yes, occupant contact	<a href="#">more</a>
V1659 — Roof Console Damaged	0	No	<a href="#">more</a>



## Case Vehicle

### Seats



Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	05	Bucket	<a href="#">more</a>
V1702 — Passenger Front Seat Type	05	Bucket	<a href="#">more</a>
V1703 — Driver Seat Mount Type	1	Standard	<a href="#">more</a>
V1704 — Passenger Seat Mount Type	1	Standard	<a href="#">more</a>
V1705 — Driver Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1706 — Passenger Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1707 — Driver Seat Original Equipment	1	Yes	<a href="#">more</a>
V1708 — Passenger Seat Original Equipment	1	Yes	<a href="#">more</a>
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1711 — Driver Seat Damage	0	None	<a href="#">more</a>
V1712 — Passenger Seat Damage	0	None	<a href="#">more</a>
V1713 — Center Front Armrest Damaged	0	No	<a href="#">more</a>
V1714 — Driver Seat Rotation	0	None apparent	<a href="#">more</a>
V1715 — Passenger Seat Rotation	0	None apparent	<a href="#">more</a>
V1716 — Driver Seat-back Type	3	Reclining	<a href="#">more</a>
V1717 — Passenger Seat-back	3	Reclining	<a href="#">more</a>

Type			
V1718 — Driver Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1719 — Passenger Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1720 — Driver Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1721 — Passenger Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1722 — Driver Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1723 — Passenger Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1724 — Driver Head Restraint Type	2	Integral	<a href="#">more</a>
V1725 — Passenger Head Restraint Type	2	Integral	<a href="#">more</a>
V1726 — Driver Head Rest Removed	8	Not applicable	<a href="#">more</a>
V1727 — Passenger Head Rest Removed	8	Not applicable	<a href="#">more</a>
V1728 — Driver Head Rest Adjustment	8	Not applicable	<a href="#">more</a>
V1729 — Passenger Head Rest Adjustment	8	Not applicable	<a href="#">more</a>
V1730 — Driver Head Rest Damage	0	None	<a href="#">more</a>
V1731 — Passenger Head Rest Damage	0	None	<a href="#">more</a>
V1732 — Driver Seat Adjustment Type	1	Manual	<a href="#">more</a>
V1733 — Passenger Seat Adjustment Type	1	Manual	<a href="#">more</a>
V1734 — Driver Seat Adjustment Provided	1	2-way	<a href="#">more</a>
V1735 — Passenger Seat Adjustment Provided	1	2-way	<a href="#">more</a>
V1736 — Driver Seat Adjuster Damage	0	None	<a href="#">more</a>

V1737 — Passenger Seat Adjuster Damage	0	None	<a href="#">more</a>
V1738 — Driver Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1739 — Passenger Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1740 — Driver Seat Pre-crash Position	2	Middle	<a href="#">more</a>
V1741 — Passenger Seat Pre-crash Position	2	Middle	<a href="#">more</a>
V1742 — Left Rear Seat Type	2	Folding	<a href="#">more</a>
V1743 — Right Rear Seat Type	2	Folding	<a href="#">more</a>
V1744 — Left Rear Seat Damaged	0	None	<a href="#">more</a>
V1745 — Right Rear Seat Damaged	0	None	<a href="#">more</a>
V1746 — Center Rear Armrest Damaged	8	Not applicable (No Center Armrest)	<a href="#">more</a>
V1747 — Left Rear Seat-back Left Lock Equipped	1	Yes	<a href="#">more</a>
V1748 — Right Rear Seat-back Left Lock Equipped	0	No	<a href="#">more</a>
V1749 — Left Rear Seat-back Left Lock Held	1	Yes	<a href="#">more</a>
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	<a href="#">more</a>
V1751 — Left Rear Seat-back Right Lock Equipped	0	No	<a href="#">more</a>
V1752 — Right Rear Seat-back Right Lock Equipped	1	Yes	<a href="#">more</a>
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	<a href="#">more</a>
V1754 — Right Rear Seat-back Right Lock Held	1	Yes	<a href="#">more</a>
V1755 — Left 3rd Seat Equipped	0	No	<a href="#">more</a>
V1756 — Right 3rd Seat Equipped	0	No	<a href="#">more</a>

V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	<a href="#">more</a>
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	<a href="#">more</a>
V1761 — Rear Head Restraints	0	Not Equipped (or removed)	<a href="#">more</a>


MEASUREMENTS IN CENTIMETERS



WINDSHIELD MARK ON CASE VEHICLE:

unknown

right-front passenger contacted rearview mirror  
and mirror contacted and cracked windshield



1 = Definitely 2 = Probably 3 = Possible


## INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	– Intruded Value	= Intrusion	
none			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	

## OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Rearview mirror	2	head	Crack, hair, grease, skin	1
B	Vertical console	2	Legs	Cracked and dented	1
C	Instrument panel	2	legs	Scuff	1
D	mid IP	2	Legs	scuff	1
E	Sunvisor	2	Head	Broke off	2
F	Airbag	2	Face	Blood	2
G	Knee bolster	1	Knee	Scuff	1
H					






A: sunview mirror  
(crack, hair, grease, skin)

E: sunvisor  
(broke off)

F: airbag  
(blood)



B: vertical console/center stack  
(cracked, dented)

# Driver Airbag

AIRBAG NUMBER ON DRIVER SIDE:

PSA-814 885-00  
T0008001 00490



Mark: ☐ 12  
Type: New theory: ☐

Mark: ☐ 12  
Type: New theory: ☐

Driver Airbag Mount



Passenger Airbag



Figure 1 (A)

If yes, how many \_\_\_\_\_

Figure 1 (B)

If yes, how many \_\_\_\_\_

Passenger Airbag Mount

Single Door



# MEASUREMENTS IN CENTIMETERS

no inspection



Bumper corner \_\_\_\_\_ Bumper corner \_\_\_\_\_  
 Skingline \_\_\_\_\_ Skingline \_\_\_\_\_



Bumper corner \_\_\_\_\_ Bumper corner \_\_\_\_\_  
 Skingline \_\_\_\_\_ Skingline \_\_\_\_\_

# Case # 337: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	03	Chest	<a href="#">more</a>
V2105 — Primary OIC -aspect	03	Central	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	CCCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 337: Occupant # 1; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	<a href="#">more</a>
V2102 — 1st Prob Contact Area	65	Steering wheel	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	23	Wrist/hand	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	06	Fracture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	19	Skeletal	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	WLFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 337: Occupant # 1; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	<a href="#">more</a>
V2102 — 1st Prob Contact Area	65	Steering wheel	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	23	Wrist/hand	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	06	Fracture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	19	Skeletal	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	WRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 337: Occupant # 2; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	06	Face	<a href="#">more</a>
V2105 — Primary OIC -aspect	09	Inferior/lower	<a href="#">more</a>
V2106 — Primary OIC -lesion	01	Abrasion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	FIAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—



## Case # 337: Occupant # 2; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	14	Neck	<a href="#">more</a>
V2105 — Primary OIC -aspect	01	Anterior/front	<a href="#">more</a>
V2106 — Primary OIC -lesion	01	Abrasion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	NAAI 1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 337: Occupant # 2; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	<a href="#">more</a>
V2102 — 1st Prob Contact Area	06	Mirror	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	06	Face	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	FLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 337: Occupant # 2; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	<a href="#">more</a>
V2102 — 1st Prob Contact Area	86	Vertical console	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	03	Chest	<a href="#">more</a>
V2105 — Primary OIC -aspect	23	Whole region	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	CWCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 337: Occupant # 2; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	24	Upper extremities	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	XLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 337: Occupant # 2; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	24	Upper extremities	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	XLLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 337: Occupant # 2; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	24	Upper extremities	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	XRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 337: Occupant # 2; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	<a href="#">more</a>
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	24	Upper extremities	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	12	Laceration	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	XRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 337: Occupant # 2; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	<a href="#">more</a>
V2102 — 1st Prob Contact Area	86	Vertical console	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	16	Pelvic/hip	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	26	Fracture with dislocation	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	10	Joints	<a href="#">more</a>
V2108 — Primary OIC -severity	3	Serious	<a href="#">more</a>
V2109 — Primary OIC	PLZJ3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—



# Case # 337: Occupant # 2; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	<a href="#">more</a>
V2102 — 1st Prob Contact Area	86	Vertical console	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	KLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 337: Occupant # 2; Injury #11

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	11	Injury #11	<a href="#">more</a>
V2102 — 1st Prob Contact Area	51	Front seat cushion	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	12	Leg (lower)	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	LLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—



















































































METRO LSI



























































P-15-05  
50-51-P




















DR



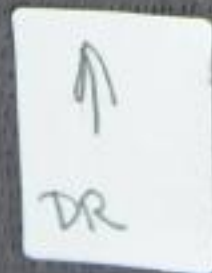











RF







↑  
#A15

↑  
SHARP

HAIR

SMUDGE











